





Specify Part No. by required I.D. and thickness.
(e.g.) I.D. is 30.2mm and thickness is 5mm.

SPW - 3005
Part No.

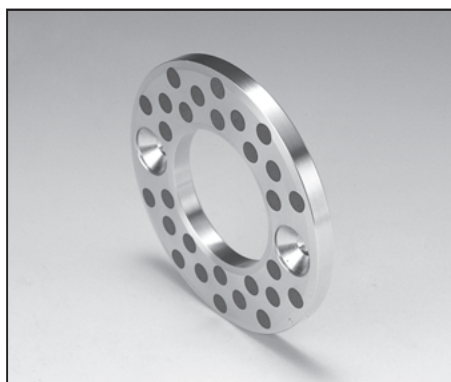

- May be combined with the SPB.
- See the description of the SPB for combination.
(Pages 187 to 190)
- The products with the N marks at the end of the part numbers have no mounting holes.

Part No.	I.D.		O.D.	Thickness		Mounting hole		
	φd	Tolerance		T	Tolerance	P.C.D.	No. of holes	Countersink screw size
SPW-0603	6.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	25	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	15	2	M3
SPW-0803	8.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	28	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	18	2	M3
SPW-1003	10.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	30	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	20	2	M3
SPW-1203	12.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	40	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	28	2	M3
SPW-1203N	12.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	40	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	no hole		
SPW-1303	13.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	40	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	28	2	M3
SPW-1403	14.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	40	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	28	2	M3
SPW-1503	15.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	50	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	35	2	M3
SPW-1603	16.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	50	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	35	2	M3
SPW-1603N	16.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	50	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	no hole		
SPW-1803	18.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	50	3	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	35	2	M3
SPW-2005	20.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	50	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	35	2	M5
SPW-2505	25.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	55	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	40	2	M5
SPW-2505N	25.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	55	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	no hole		
SPW-3005	30.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	60	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	45	2	M5
SPW-3005N	30.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	60	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	no hole		
SPW-3505	35.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	70	5	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	50	2	M5

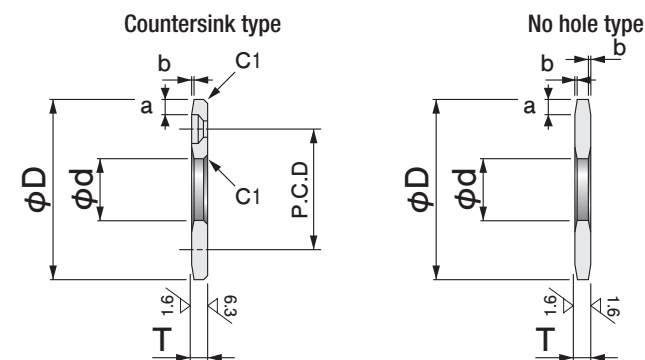

a b: Chamfering for I.D. and O.D.

φd	~10.2	~18.2	~35.2	~45.2	~55.3	~100.5	120.5
a	1.5	2	2.5	3	4	5	4
b	0.3	0.4	0.4	0.5	0.6	0.8	0.8

(mm)

Part No.	I.D.		O.D.	Thickness		Mounting hole		
	φd	Tolerance		T	Tolerance	P.C.D.	No. of holes	Countersink screw size
SPW-4007	40.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	80	7	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	60	2	M6
SPW-4507	45.2	$\begin{smallmatrix} +0.2 \\ +0.1 \end{smallmatrix}$	90	7	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	70	2	M6
SPW-5008	50.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	100	8	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	75	4	M6
SPW-5508	55.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	110	8	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	85	4	M6
SPW-6008	60.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	120	8	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	90	4	M8
SPW-6508	65.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	125	8	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	95	4	M8
SPW-7010	70.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	130	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	100	4	M8
SPW-7510	75.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	140	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	110	4	M8
SPW-8010	80.3	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	150	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	120	4	M8
SPW-9010	90.5	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	170	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	140	4	M10
SPW-10010	100.5	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	190	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	160	4	M10
SPW-12010	120.5	$\begin{smallmatrix} +0.3 \\ +0.1 \end{smallmatrix}$	200	10	$\begin{smallmatrix} 0 \\ -0.1 \end{smallmatrix}$	175	4	M10