


MOLD CLAMP ASSEMBLY DIAGRAM (CG - □ B)

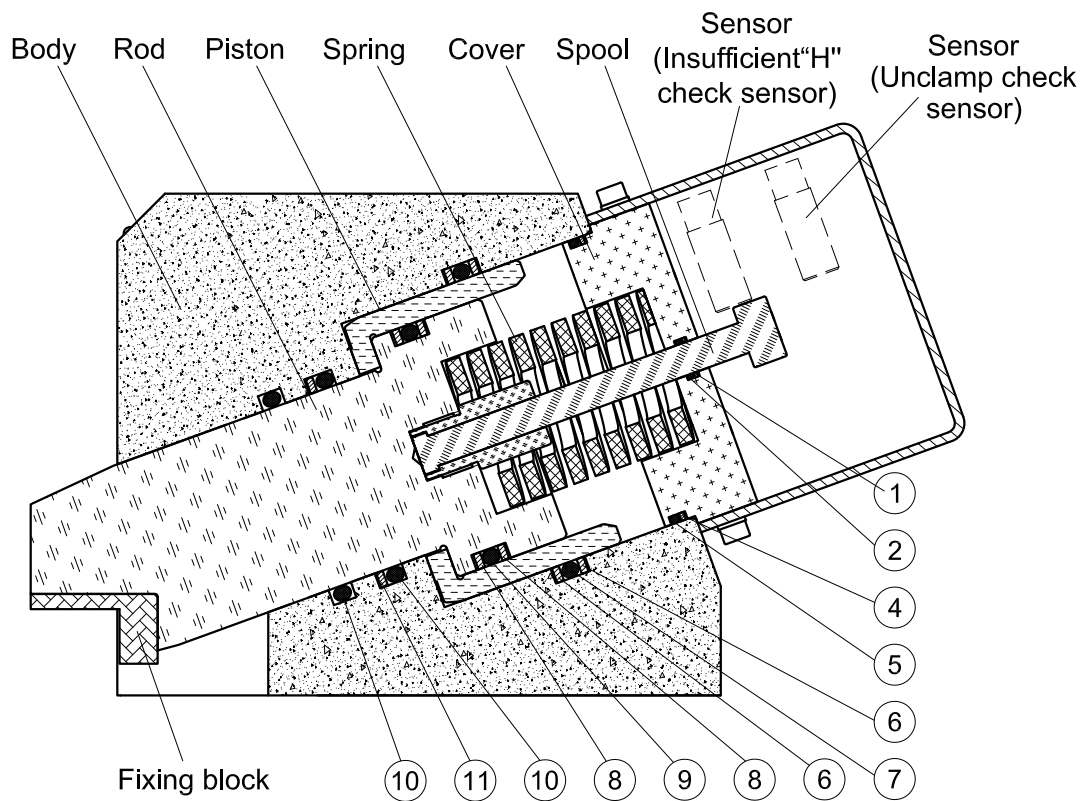

Thickness of template : $H \pm 0.5\text{mm}$

Model selection	CG-4B	CG-6B	CG-10B	CG-16B	CG-25B	CG-50B
① Back-up ring	TP-10					TP-14
② O-ring	AP-10					AP-14
④ Back-up ring	TG-55	TG-65	TG-80	TG-90	TG-110	TG-150
⑤ O-ring	BG-55	BG-65	BG-80	BG-90	AG-110	AG-150
⑥ Back-up ring	TP-60	TP-70	TP-85	TP-95	TP-115	TP-160
⑦ O-ring	AP-60	AP-70	AP-85	AP-95	AP-115	AP-160
⑧ Back-up ring	TP-44	TP-50A	TP-60	TP-70	TP-90	TP-130
⑨ O-ring	AP-44	AP-50A	AP-60	AP-70	AP-90	AP-130
⑩ O-ring	AP-35	AP-45	AP-50	AP-60	AP-75	AP-100
⑪ Back-up ring	TP-35	TP-45	TP-50	TP-60	TP-75	TP-100

Select	Sensor	Explanation	Remark
	PM12-02N-S	DC10~30V , NPN (3 - wires)	FOTEX
	PM12-02P-S	DC10~30V , PNP (3 - wires)	FOTEX
	PM12-02-S	AC90~250V (2 - wires)	FOTEX