

Fitting accessories - Valves



Needle valve VM-1

Material 316ss

Medium temperature, working pressure – according to the graph on page III/ 7

Ordering code:

Valve VM-1/M (input M20×1.5 M, output M20×1.5 F, Teflon packing)

Valve VM-1/G (input G1/2" M, output G1/2" F, Teflon packing)

Valve VM-1/M/oxygen (valve designed for contact with oxygen; input M20×1.5 M, output M20×1.5 F, Teflon packing)



Needle valve VM-1-R/R

Material 316ss


Medium temperature, working pressure – according to the graph on page IV/ 3

Input 1/2NPT F, output 1/2NPT F, Graphite packing, no vent port

Ordering code:

Valve VM-1-R/R/_

- 1 – Set of weldable stainless steel connectors (316ss)
- 2 – Set of weldable steel connectors (K11562)
- 3 – Set of connectors with Ø12 clamping ring
- 4 – Set of connectors with Ø14 clamping ring
- 5 – 1/2NPT nipple connector

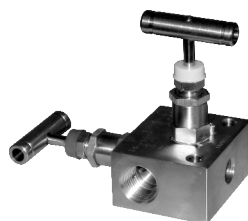

2-Valve Manifold VM-2-R/R

Material 316ss

Medium temperature, working pressure – according to the graph on page IV/ 3

Input 1/2NPT F, output 1/2NPT F, Teflon packing, vent port 1/4 NPT F

Ordering code:

Valve VM-2-R/R/_

Valve VM-2-R/R/_

- 1 – Set of weldable stainless steel connectors (316ss)
- 2 – Set of weldable steel connectors (K11562)
- 3 – Set of connectors with Ø12 clamping ring
- 4 – Set of connectors with Ø14 clamping ring
- 5 – 1/2NPT nipple connector

Option:

.../NACE - NACE MR-01-75 comply



2-Valve Manifold VM-2-RM

Material 316ss

Medium temperature, working pressure – according to the graph on page IV/ 3

Ordering code:

Valve VM-2-RM/M (input M20×1.5 M, output M20×1.5 F, Teflon packing, vent port 1/4 NPT F)


Valve VM-2-RM/G (input G1/2" M, output G1/2" F, Teflon packing, vent port 1/4 NPT F)

Valve VM-2-RM/1/2NPT (input 1/2"NPT M, output 1/2"NPT F, Teflon packing, vent port 1/4 NPT F)


Option:

.../NACE - NACE MR-01-75 comply

Transmission tubes

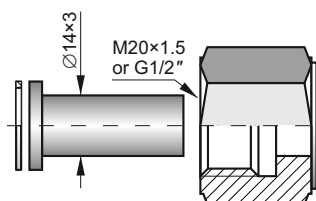


Connector to weld
Materials: 15HM – (SO) or 316Lss (S)
Ordering code
RedSpaw – S or SO / M20×1.5 or G1/2"

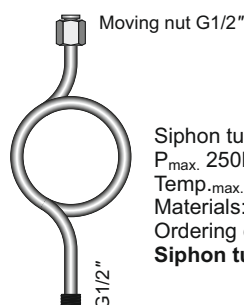

Moving nut G1/2"


Siphon tube
P_{max.} 250bar
Temp._{max.} 300°C
Materials: 321ss
Ordering code
Siphon tube – S G1/2"

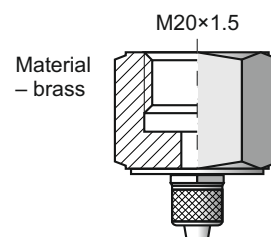


Material – brass

Ø6×1 elastic tube
Ordering code:
RedØ6 – M


Fitting sockets

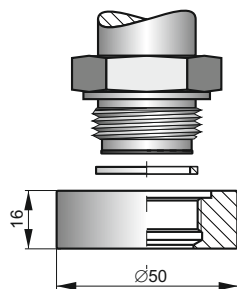

Socket with M30×2 thread for fitting transmitters with a CM30×2 process connection
Material – 316Lss
Sealing – teflon
Ordering code **Socket CM30×2**

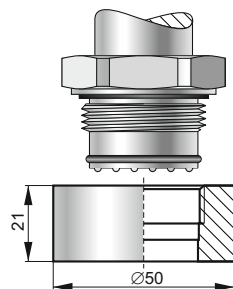


Socket with G1" thread for fitting transmitters with a CG1 process connection
Material – 316Lss
Sealing – teflon
Ordering code **Socket CG1**

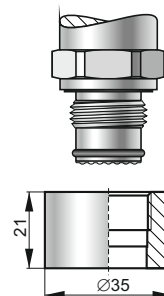

Socket with G1/2" thread for fitting transmitters with a CG1/2 process connection
Material – 316Lss
Sealing – teflon
Ordering code **Socket CG1/2**

Mounting brackets

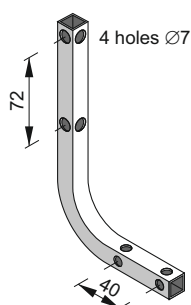

Clasp
for fitting
on a pipe



Universal mounting bracket for fitting APC-2000 and APR-2000 transmitters with aluminium casing in any desired position on a vertical or horizontal pipe (Ø30...Ø50)

Ordering code:

AL: material zincd steel


AL(SS): material ss304

AL(SS316): material ss316

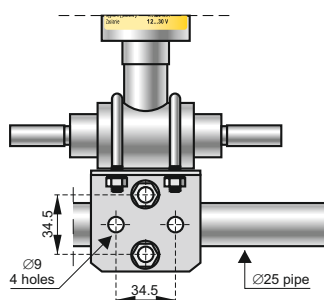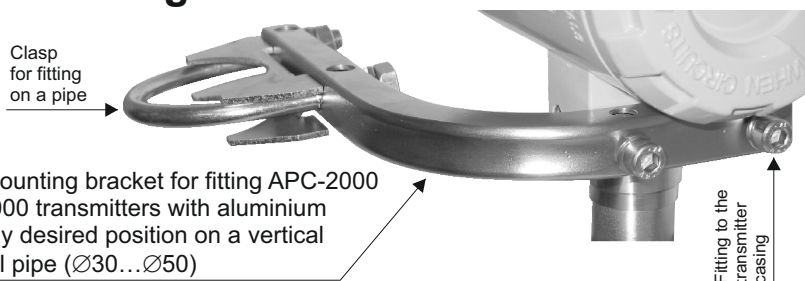

Mounting bracket for fitting differential pressure transmitters with P type process connections on a Ø25 pipe.
Ordering code:

Mounting bracket FI 25

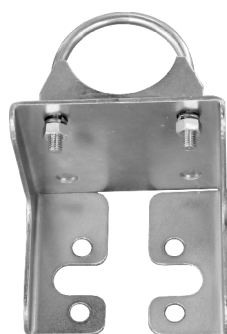

Mounting bracket for fitting differential pressure transmitters with C and C(7/16) type process connections on a 2" pipe or on a wall

Ordering code:

C-2": mat. zincd steel, screws M10


C-2"(SS): mat. ss304, screws M10

C-2"(SS316): mat. ss316, screws M10


C-2"B: mat. zincd steel, screws 7/16"UNF

C-2"B(SS): mat. ss304, screws 7/16"UNF

C-2"B(SS316): mat. ss316, screws 7/16"UNF

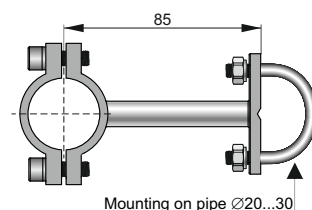

Mounting on pipe Ø20...30

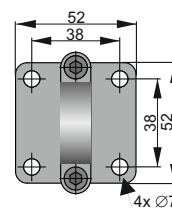

PC - mounting bracket for fitting on wall / flat surface, mat. ss304
PCR - mounting bracket for fitting on pipe, mat. ss304